

Specifications 7556 Digital Resistance Meter

Range and Resolution

● Deviation Display

* Percent Limit : 9.99 Mode

Input reference value range	Selected range	Reading range (Deviational value)	
		755601	755611
0.0001Ω to 1.0009Ω	1Ω		
1.001Ω to 10.009Ω	10Ω		
10.01Ω to 100.09Ω	100Ω		
0.1001kΩ to 1.0009kΩ	1kΩ	-99.99% to 19.99%	-99.999% to 19.999%
1.001kΩ to 10.009kΩ	10kΩ		
10.01kΩ to 100.09kΩ	100kΩ		
0.1001MΩ to 1.0009MΩ	1MΩ		
1.001MΩ to 10.009MΩ	10MΩ		
10.01MΩ to 120.00MΩ	100MΩ		

* Percent Limit : 99.9 Mode

Input reference value range	Selected range	Reading range (Deviational value)	
		755601	755611
0.001Ω to 1.009Ω	10Ω		
1.01Ω to 10.09Ω	100Ω		
10.01Ω to 100.09Ω	1kΩ		
0.101kΩ to 1.009kΩ	10kΩ	-99.9% to 199.9%	-99.99% to 199.99%
1.01kΩ to 10.09kΩ	100kΩ		
10.1kΩ to 100.9kΩ	1MΩ		
0.101MΩ to 1.009MΩ	10MΩ		
1.01MΩ to 120.0MΩ	100MΩ		

* Auto-ranging based on reference input.

* "-OL-" is displayed if the display range is exceeded.

* "-OL-" is displayed if 120% of the range is exceeded.

* Resolution: 0.01% on 755601, 0.001% on 755611

● Absolute Value Display

Range	Maximum display		Resolution	
	755601	755611	755601	755611
1Ω	1.2000	1.20000	100μΩ	10μΩ
10Ω	12.000	12.0000	1mΩ	100μΩ
100Ω	120.00	120.000	10mΩ	1mΩ
1kΩ	1.2000	1.20000	100mΩ	10mΩ
10kΩ	12.000	12.0000	1Ω	100mΩ
100kΩ	120.00	120.000	10Ω	1Ω
1MΩ	1.2000	1.20000	100Ω	10Ω
10MΩ	12.000	12.0000	1kΩ	100Ω
100MΩ	120.00	120.000	10kΩ	1kΩ

* Displayed digits: 4.5 on 755601, 5.5 on 755611

Range and Measured Current

Range	Measured current
1Ω	100mA
10Ω	10mA
100Ω	1mA
1kΩ	100μA
10kΩ	50μA
100kΩ	5μA
1MΩ	500nA
10MΩ	50nA
100MΩ	50nA

Accuracy

● 755601 (one year after calibration, at 23 ± 5°C)

Range	Measurement mode		
	Normal	Fast	High Speed
1Ω	0.02 + 2	0.02 + 3	0.02 + 5
10Ω	0.02 + 1	0.02 + 2	0.02 + 4
100Ω	0.02 + 1	0.02 + 2	0.02 + 4
1kΩ	0.015 + 1	0.015 + 2	0.015 + 4
10kΩ	0.015 + 1	0.015 + 2	0.015 + 4
100kΩ	0.015 + 1	0.015 + 2	0.015 + 4
1MΩ	0.02 + 1	0.1 + 2	0.1 + 4
10MΩ	0.04 + 1	0.3 + 2	0.3 + 4
100MΩ	0.2 + 2	—	—

* The above accuracy figures are for ±9.99% mode (multiply by 10 for the values in ±99.9% mode).

* ± (% of reading + digits)

* At 5 to 18°C and 28 to 40°C, the following addition is made: temperature coefficient ± (10% of measurement accuracy)/°C

● 755611 (90 days after calibration, at 23 ± 5°C)

Range	Measurement mode		
	Normal	Fast	High Speed
1Ω	0.012 + 10	0.012 + 20	0.012 + 30
10Ω	0.01 + 3	0.01 + 10	0.01 + 20
100Ω	0.008 + 3	0.008 + 10	0.008 + 20
1kΩ	0.006 + 3	0.006 + 10	0.006 + 20
10kΩ	0.006 + 3	0.006 + 10	0.006 + 20
100kΩ	0.006 + 3	0.006 + 10	0.006 + 20
1MΩ	0.01 + 4	0.01 + 20	0.01 + 40
10MΩ	0.03 + 10	0.3 + 20	0.3 + 40
100MΩ	0.2 + 20	—	—

● 755611 (1 year after calibration, at 23 ± 5°C)

Range	Measurement mode		
	Normal	Fast	High Speed
1Ω	0.015 + 10	0.015 + 20	0.015 + 30
10Ω	0.012 + 3	0.012 + 10	0.012 + 20
100Ω	0.011 + 3	0.011 + 10	0.011 + 20
1kΩ	0.009 + 3	0.009 + 10	0.009 + 20
10kΩ	0.009 + 3	0.009 + 10	0.009 + 20
100kΩ	0.009 + 3	0.009 + 10	0.009 + 20
1MΩ	0.015 + 4	0.015 + 20	0.015 + 40
10MΩ	0.04 + 10	0.3 + 20	0.3 + 40
100MΩ	0.2 + 20	—	—

* The above accuracy figures are for ±9.99% mode (multiply by 10 for the values in ±99.9% mode).
* ± (% of reading + digits), 1 digit = 0.001%
* At 5 to 18°C and 28 to 40°C, the following addition is made: temperature coefficient ± (10% of measurement accuracy)/°C

Trigger

● Trigger Delay (for EXTERNAL and MANUAL trigger modes)

Setting range	Resolution
0 to 1000ms	0.1ms

Measurement Time (for EXTERNAL trigger mode)

Mode	Measurement time
Normal	60Hz
	50Hz
Fast	19.9ms
	23.2ms
High Speed	5.7ms
	2.8ms

* Measurement time: From trigger input to fall of EOM

* Add 2 ms when contact check is used prior to measurement.

* Add 1 ms when contact check is used after measurement.

* Add 4 ms for a 10 MΩ range.

* Add 50 ms for a 100 MΩ range.

Contact Check Function

Check level	Setting range	Resolution
	1 to 30Ω	1Ω

* Execute checks before or after a measurement (selectable).

* Check current : 50 mA

* Display when contact check error is detected : "-nC-"

Judgment : HI , Handler interface : NO CONTACT, HI output

* Display when measured current abnormality is detected : "-CF-"

Judgment : HI , Handler interface : NO CONTACT, HI output

Comparator Function

● Setting Range (755601)

Parameter	Deviation setting range		Absolute value setting range
	±9.99% mode	±99.9% mode	
Hi	-9.99% to 9.99%	-99.9% to 99.9%	0.000Ω to 1.200Ω
Lo	-9.99% to 9.99%	-99.9% to 99.9%	0.000Ω to 1.200Ω

● Setting Range (755611)

Parameter	Deviation setting range		Absolute value setting range
	±9.999% mode	±99.99% mode	
Hi	-9.999% to 9.999%	-99.99% to 99.99%	0.0000Ω to 1.2000Ω
Lo	-9.999% to 9.999%	-99.99% to 99.99%	0.0000Ω to 1.2000Ω

Data Memory

* Number of stored entries: Maximum 2000 data entries

Handler Interface (optically isolated open collector signal)

Signal name		Active state	Load
EXT TRIG	In	Rising or falling edge	—
HOLD	In	L	—
INDEX	Out	L	25mA
EOM	Out	L	25mA
NO CONTACT	Out	L	25mA
HI	Out	L	25mA
IN	Out	L	25mA
LO	Out	L	25mA
+12V	Out	—	50mA
COM	—	—	—

* Voltage between individual signals and case : Maximum 42 Vpeak

* EOM pulse width selection : 0.1 ms, 5 ms, 10 ms, 15 ms

Communication Interfaces


- Serial (RS-232) (standard)
- GP-IB (optional)

Centronics Interface (optional)

● Output

Stored data	Maximum 2000 entries
Panel settings	Reference value, HI limit, LO limit
Comparator results	HI, IN, and LO counts
Contact check error	Contact check error (including detection of measured current abnormality)
Statistics	Number of valid samples, number of invalid samples : Counts for -oL-, -nC- and -CF- Maximum, minimum, range (maximum to minimum), average, standard deviation σ , 3σ (6 valid digits or 6 digits below decimal point)

■ Exterior

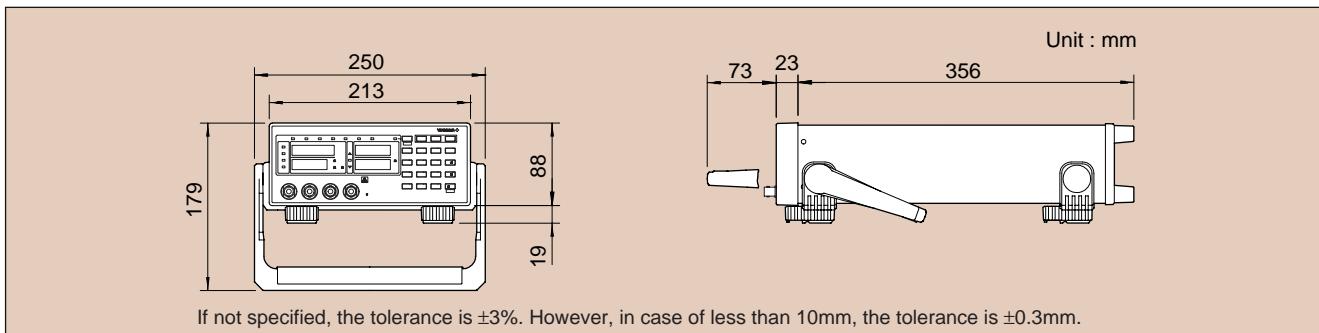

General Specifications

Display	7-segment LED
Maximum terminal input	42 Vpeak (between individual measurement terminals and case)
Operating temperature range	5 to 40°C
Operating humidity range	20 to 80% RH
Storage temperature range	-25 to 60°C
Consumed power	25 VA or less
Warmup time	30 minutes minimum

■ Models and Suffix Codes

Main Unit

Model	Suffix code	Description
755601	Digital resistance meter
755611	Digital resistance meter (Highly accurate)
Supply voltage	-1	100 V AC, 50/60 Hz
	-4	120 V AC, 50/60 Hz
	-6	220 V AC, 50/60 Hz
	-8	240 V AC, 50/60 Hz
Power cord	-D	UL/CSA standard
	-F	VDE standard
	-R	SAA standard
	-Q	BS standard
Optional Features	/C1	GP-IB interface
	/C2	Centronics interface
	/C3	GP-IB + Centronics interface